

Receptacle Adapter Ultrasonic and One-Piece Die Cast Assembly Operations

1. SCOPE


This specification covers the acceptable requirements and the not acceptable conditions for the Receptacle Adapter Ultrasonic and One-Piece Die Cast Assembly Operations.

2. INSPECTION CRITERIA

Unless otherwise specified, figures are shown at approximately 10X magnification. The Ultrasonic Assembly and the Die Cast Assembly will be inspected without magnification.



Even though the pictorials shown in this document are of the SC product family, they are representative of all types of receptacle adapters.

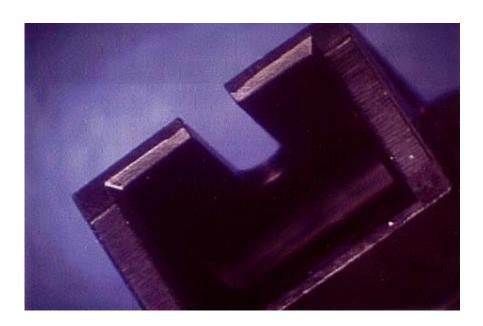

ACCEPTABLE


Tool Marks

Figure 1

NOTE

If less than 50% of the lead in chamfer has been damaged due to tool marks, the part is considered ACCEPTABLE.



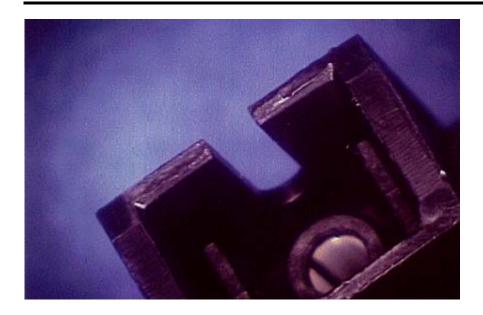

Tool Marks

Figure 2

NOTE

If 50% or more of the lead in chamfer has been damaged due to tool marks, the part is considered NOT ACCEPTABLE



ACCEPTABLE

Tool Marks on Flange

Figure 3


Rev F 2 of 7





Tool Marks on Flange

Figure 4

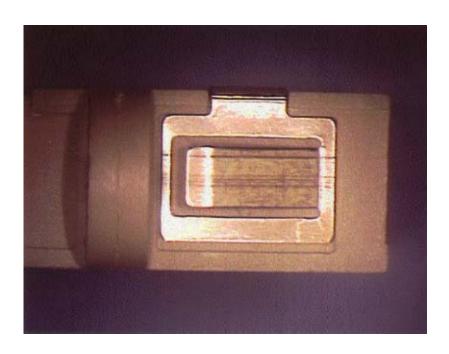


ACCEPTABLE

Position of Ears on Retention Clip

Figure 5


Rev F 3 of 7



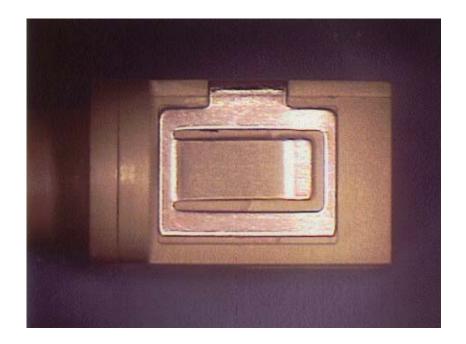

Position of Ears on Retention Clip

Figure 6

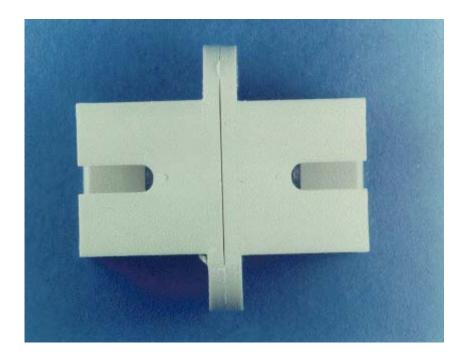

ACCEPTABLE

Direction of Keyway (Both in Same Direction)

Figure 7

Rev F 4 of 7





Direction of Keyway (One in the Front, One in the Back)

Figure 8




NOT ACCEPTABLE

Flash

Figure 9


Rev F 5 of 7



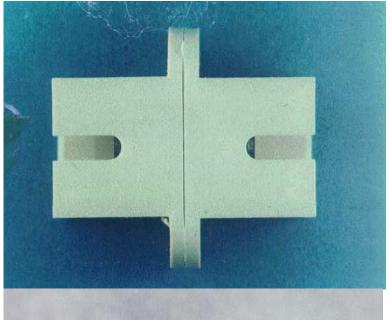

Allowable Gap (Up to 0.010 inch Gap is Allowed)


Figure 10

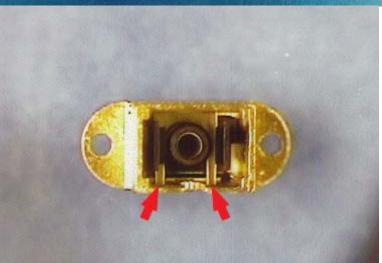

ACCEPTABLE

Correct Retaining Fork Placement (Viewed from the SC Side of Adapter)

Figure 11

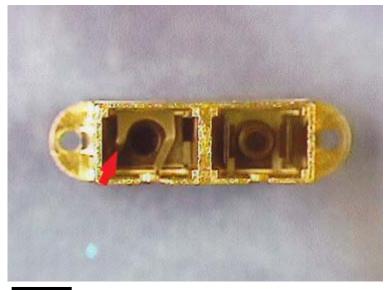

NOT ACCEPTABLE

Damaged Retaining Fork Placement (Viewed from the SC Side of Adapter)

Figure 12


NOTE

The acceptable and not acceptable conditions in Figures 11 and 12 apply to both Simplex and Duplex Adapters.


Rev F 6 of 7





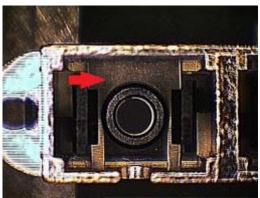



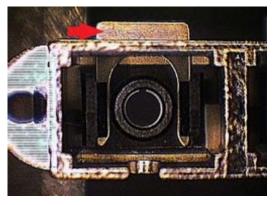

NOTE

The acceptable and not acceptable conditions in Figures 13 and 14 apply to both Simplex and Duplex Adapters.

ACCEPTABLE

Fully Seated Retaining Fork

Figure 13

NOT ACCEPTABLE

Unseated Retaining Fork

Figure 14

Rev F 7 of 7